

# CUSTOMER SERVICE BULLETIN

## Radio Shack® CUSTOMER SERVICE BULLETIN

400 Atrium—One Tandy Center, Fort Worth, Texas 76102

Bulletin No.	1590-02
Description	SUPERSCRIPSIT
Model	Model III
Stock No.	26-1590 Ver. 01.02.00
Date	July 13, 1983
Page 1 of	1

### Problem

While doing a merge, SuperSCRIPSIT fails to recognize the first line of a paragraph for indentation purposes.

\* \* THE FOLLOWING PATCHES ARE REQUIRED FOR MODEL III ONLY! \* \*

### Solution

Apply the following patches to correct the problem.

```
PATCH SCRIPSIT/CMD (ADD=7C96,FIND=0000000,CHG=21A0E0)
PATCH SCRIPSIT/CMD (ADD=7C99,FIND=00000000,CHG=36EF23C9)
PATCH SCR64/CTL (ADD=87F5,FIND=21A1E0,CHG=CD967C)
```

Apply the following patch to change the version number.

```
PATCH SCR17/CTL (ADD=8EC7,FIND=202A,CHG=3120)
```

After patches from this Bulletin have been applied, the version number will be 01.02.01. Please make the necessary entry in your Version Log.