

# CUSTOMER SERVICE BULLETIN

## Radio Shack® CUSTOMER SERVICE BULLETIN

400 Atrium—One Tandy Center, Fort Worth, Texas 76102

|                     |                       |
|---------------------|-----------------------|
| <b>Bulletin No.</b> | 4835-01               |
| <b>Description</b>  | SCRIPSIT 3.0          |
| <b>Model</b>        | Model II/12           |
| <b>Stock No.</b>    | 26-4835 Ver. 03.00.00 |
| <b>Date</b>         | June 27, 1983         |
| <b>Page 1 of</b>    | 1                     |

### Problem

1. Text block can be lost during repagination with hyphenation.
2. Strange results occur when more than 31 documents files are acquired in the system.

\* \* THE FOLLOWING PATCHES ARE REQUIRED! \* \*

### Solution

To fix the problem with repagination and hyphenation, apply the following patches.

```
PATCH SCRIPSIT/SYS R=54 B=173 F=60 C=88
PATCH SCRIPSIT/SYS R=54 B=207 F=60 C=88
PATCH SCRIPSIT/SYS R=54 B=237 F=60 C=88
PATCH SCRIPSIT/SYS R=57 B=94 F=60 C=88
PATCH SCRIPSIT/SYS R=43 B=21 F=22CC C=A0DC
PATCH SCRIPSIT/CMD A=DCA0 F=20202020202020 C=CD2DB4C0C322CC
```

To fix the problem in the directory, apply the following patches.

```
PATCH SCRIPSIT/SYS R=4 B=250 F=320140 C=CD11DB
PATCH SCRIPSIT/CMD A=DB11 F=202020202020 C=320140E52103
PATCH SCRIPSIT/CMD A=DB17 F=202020202020 C=40CBAE7EE1C9
```

Apply the following patch to change the version number from 03.00.00 to 03.00.01.

```
PATCH SCRIPSIT A=E330 F=30 C=31
```